

TECHNICAL REPORT

for

Matteo Bortolossi Abitex SRL

IT 04453620280 Via E. Fermi 9 Cadoneghe (PD) ITALY 35010

Customer Order No:

TBC

Job Reference:

EFS624101027-CG-01

Supplied by:

Not Specified

Date received:

30/10/2024

Supplying to:

Not Specified

Date issued:

28/11/2024

Testing Period:

30/10/2024 - 28/11/2024

Testing to Nabucco Bio Base 02038



The samples tested in this report have been assessed against the requirements of the specifications listed for the SELECTED TESTS ONLY. Statements of compliance against any specification relate exclusively to the sample tested as requested by the client and may not be representative of full specification testing:

BS 7176+A1 Medium Hazard

According to the requirements, the sample(s) were found to:

Comply

With the requirements of the above specification.

Additional comments/information (if relevant)

James Brennan Physical Testing Technician

(Footwear Specialist)

Daniel Holmes Head of Physical Testing.

Eurofins BLC Leather Technology Centre Limited Kings Park Road, Moulton Park, Northampton, NN3 6JD

Tel: +44 (0) 1604 679999

Website: www.blcleathertech.com email: ERFBLCinfo@cpt.eurofinseu.com



CPSC LABORATORY IDENTIFICATION NUMBER

1049

EFS624101027-CG-01 Job Ref:

Abitex SRL

AR-24-S6-009765-01 AR Ref:

Page No: Page 1 of 10



DETAILS OF SAMPLE RECEIVED

Sample Reference	Description	Unique Reference/Identifier
Α	Nabucco Bio Base 02038	243363001

CERTIFICATE OF ANALYSIS

† † BS 5852:2006 Ignition Source 5

-	Test Results	
-	1	2
4.2.1 a)	No	No
4.2.1 a) Time that the test was stopped due to flaming ignition (if applicable)	N/A	N/A
4.2.1 b)	No	No
4.2.1 c)	No	No
4.2.1 e)	No	No
4.2.1 g)	No	No
4.1.1 a)	No	No
4.1.1 a) Time that the test was stopped due to progressive smouldering ignition (if applicable)	No	No
4.1.1 c)	N/A	N/A
4.1.1 e)	No	No
4.1.1 f)	No	No
Was the samples subjected to water soaking?	Yes	Yes

†SMOULDERING CIGARETTE TEST - BS EN 1021-1:2014 (SMOULDERING CIGARETTE SOURCE)

-	Test Results			
-	1	2	3	
Progressive smouldering after 60 minutes	No	No	No	
Flaming?	No	No	No	
Tested with	CM 35 FR Foam	CM 35 FR Foam	CM 35 FR Foam	
Was the samples subjected to water soaking?	Yes	Yes	Yes	

Website: www.blcleathertech.com email: ERFBLCinfo@cpt.eurofinseu.com



CPSC LABORATORY IDENTIFICATION NUMBER 1049

EFS624101027-CG-01 Job Ref:

Abitex SRL

AR-24-S6-009765-01 AR Ref:

Page No: Page 2 of 10



†BUTANE FLAME TEST - BS EN 1021-2:2014 (MATCH FLAME EQUIVALENT SOURCE)

-	Test Results		
-	1	2	3
Ignition source removed at (seconds)	15	15	15
Flaming ceased at (seconds)	1	1	1
Flaming still in progress 120 seconds after removal of ignition source?	No	No	No
Progressive smouldering?	No	No	No
Tested with	CM 35 FR Foam	CM 35 FR Foam	CM 35 FR Foam
Was the samples subjected to water soaking?	Yes	Yes	Yes

Test	Conclusion Pass/Fail
††BS 5852:2006 Ignition Source 5	Pass
†SMOULDERING CIGARETTE TEST - BS EN 1021-1:2014 (SMOULDERING CIGARETTE SOURCE)	Pass
†BUTANE FLAME TEST - BS EN 1021-2:2014 (MATCH FLAME EQUIVALENT SOURCE)	Pass

Website: www.blcleathertech.com email: ERFBLCinfo@cpt.eurofinseu.com



CPSC LABORATORY IDENTIFICATION NUMBER 1049

EFS624101027-CG-01 Job Ref:

Abitex SRL


AR-24-S6-009765-01 AR Ref:

Page No: Page 3 of 10



TESTING IMAGE



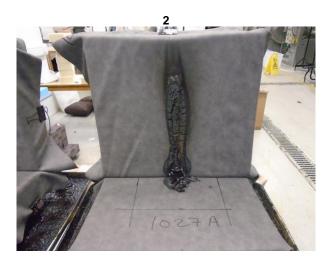

Eurofins BLC Leather Technology Centre Limited Kings Park Road, Moulton Park, Northampton, NN3 6JD

Tel: +44 (0) 1604 679999

Website: www.blcleathertech.com email: ERFBLCinfo@cpt.eurofinseu.com




CPSC LABORATORY IDENTIFICATION NUMBER 1049

EFS624101027-CG-01 Abitex SRL Job Ref:

AR-24-S6-009765-01 AR Ref:

Page 4 of 10 Page No:



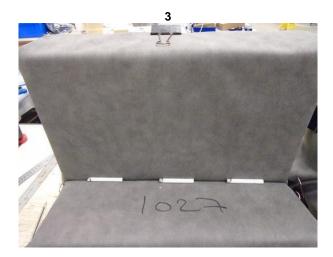



Website: www.blcleathertech.com email: ERFBLCinfo@cpt.eurofinseu.com





UNCERTAINTY OF MEASUREMENT

The reported expanded uncertainty is based on a standard uncertainty multiplied by a coverage factor of k = 2, providing a level of confidence of approximately 95 %.

Unless otherwise specified all compliance and pass/fail statements for physical test methods are binary simple acceptance based on the tolerance interval and, except for graded methods, a test uncertainty ratio greater (TUR) than 4:1.

For graded methods, the TUR will drop to as low as 0.5:1 when the tolerance limits are within a grade division of the upper scale limit.

The Uncertainty budgets are stated for each test method, these are for reference, and should be considered when results are on or close to Specification Limits / Requirements. In such cases, it should be noted that the risk of false acceptance or rejection may be as high as 50%, for further information please refer to ILAC G8.

Test Method	Parameter	Uncertainty of Measurement (±)
Ignitability of Foam Fillings (Furniture & Furnishings (Fire)(Safety) Regulations 1988 (as amended) – Schedule 1)	Ignition Source 5	2 seconds
Ignitability of Non-Foam Fillings (Furniture & Furnishings (Fire)(Safety) Regulations 1988 (as amended) – Schedule 2)	Ignition Source 2	2 seconds
Ignitability of Interliners (Furniture & Furnishings (Fire)(Safety) Regulations 1988 (as amended) – Schedule 3)	Ignition Source 5	2 seconds
Ignitability of Fabric	Ignition Source 0	2 seconds
(Furniture & Furnishings (Fire)(Safety) Regulations 1988 (as amended) – Schedule 4 & 5)	Ignition Source 1	2 seconds
Ignitability of Upholstered Seating by Smouldering and Flaming Ignition Sources (BS 5852:2006)	Ignition Source 5	2 seconds
Assessment of the ignitability of upholstered furniture Part 1: Ignition source smouldering cigarette (BS EN 1021-1:2006 / BS EN 1021-1:2014)	Cigarette Ignition Source	2 seconds
Assessment of the ignitability of upholstered furniture Part 2: Ignition source match flame equivalent (BS EN 1021-2:2006 / BS EN 1021-2:2014)	Match Flame Equivalent Ignition Source	2 seconds
Smoulder Resistance of Materials Used in Upholstered Furniture	Smouldering Time Measurement	2 seconds
(TB 117)	Vertical Char Measurement	0.032 inches
Standard for the Flammability of Clothing Textiles	Class I Designation	0.526%
(16 CFR 1610)	Class III Designation	0.982%
Standard for the Flammability of Carpets and Rugs	After Flame Time Measurements	0.245 seconds
(16 CFR 1630)	Damaged Length Measurement	0.0817 cm
Standard for the Flammability of Small Carpets and Rugs	After Flame Time Measurements	0.245 seconds
(16 CFR 1631)	Damaged Length Measurement	0.0817 cm
Assessment of the ignitability of mattresses and upholstered bed bases Part 1: Ignition source smouldering cigarette (BS EN 597-1:1995 / BS EN 597-1:2015)	Smouldering Cigarette	2 seconds
Assessment of the ignitability of mattresses and upholstered bed bases Part 2: Ignition source: match flame equivalent (BS EN 597-2:1995 / BS EN 597-2:2015)	Match Flame Equivalent	2 seconds
Methods of test for the assessment of the ignitability of mattresses, upholstered divans and upholstered bed bases with flaming types of primary and secondary sources of ignition. (BS 6807:2006 / BS 7177:2008 + A1:2011)	Ignition Source 5	2 seconds

Eurofins BLC Leather Technology Centre Limited Kings Park Road, Moulton Park, Northampton, NN3 6JD Tel: +44 (0) 1604 679999

Website: www.blcleathertech.com email: ERFBLCinfo@cpt.eurofinseu.com



CPSC LABORATORY IDENTIFICATION NUMBER 1049 Job Ref: EFS624101027-CG-01

Abitex SRL

AR Ref: AR-24-S6-009765-01

Page No: Page 6 of 10



STANDARD TECHNICAL NOTES

(all may not be applicable)

	(all may not be applicable)
Terms and Conditions	Our Terms and Conditions of Testing can be found at www.blcleathertech.com
†	Test within the scope of Eurofins BLC's internal ISO 17025 UKAS accreditation.
SC■	Testing performed within the scope of an external ISO 17025 UKAS accredited body (a Eurofins BLC approved partner laboratory)
SC◊	Testing performed within the scope of an external ISO 17025 accredited body (a Eurofins BLC approved partner laboratory)
SC	Test performed by an unaccredited Eurofins BLC approved partner laboratory.
	Technical Notes (listed by test method)
	Foam, sheeting, cigarettes, and upholstery samples are conditioned for at least 4 days prior to testing at 21 ± 3°C and < 55% Humidity. The flammability conditioning chamber is suitable for this.
Sample conditioning	NOTE: TB 117 specifies a minimum of 24 hours, however, BLC has standardised conditioning to 4 days for consistency with the other flammability tests, thereby eliminating potential for confusion. If conditions in the test area are not the same as in the conditioning area, tests should begin within 10 minutes of removal of samples from conditioning area.
Ignitability testing to †BS 5852: Part 1:1979 as specified in Schedule 4, Part 1 (the cigarette test) and Schedule 5, Part 1 (the match test) of the Furniture and Furnishings (Fire)(Safety) Regulations 1988 and The Furniture and Furnishings (Fire) (Safety) (Amendment) Regulations 1989	The test results relate only to the ignitability of the combinations of materials under the particular conditions of test; they are not intended as a means of assessing the full potential fire hazard of the materials in use. Filling type: VP45 Non FR modified foam with a density of 20-22 Kg/m ³
†BS EN 1021-1:2014 (Smouldering cigarette source) and †BS EN 1021-2:2014 (Match flame equivalent source)	The test results relate only to the ignitability of the combination of materials under the particular conditions of test; they are not intended as a means of assessing the full potential fire hazard of the materials in use

Website: www.blcleathertech.com email: ERFBLCinfo@cpt.eurofinseu.com



CPSC LABORATORY IDENTIFICATION NUMBER 1049

EFS624101027-CG-01 Job Ref:

Abitex SRL

AR-24-S6-009765-01 AR Ref:

Page No: Page 7 of 10



	The test results only relate to the ignitability of the combinations of materials under the particular conditions of test; they are not intended as a means of assessing the full potential fire hazard of the materials in use
	4.2.1 a) Escalating flaming combustion behaviour so that it is unsafe to continue the test and forcible extinction is required
	4.2.1 b) Burns until it is essentially consumed within the test duration
	4.2.1 c) Flame front reaches the extremities of the specimen other than the top of the vertical part
	of the test specimen, or passes through the full thickness of the specimen within the duration of the test
	4.2.1 e) Continues to flame for more than 10 minutes after ignition of the crib
†BS 5852:2006 Ignition Source 5	4.2.1 g) Flaming debris causes an isolated floor fire that continues to flame longer than 10 minutes after ignition of the crib
	4.1.1 a) Escalating smouldering combustion behaviour so that it is unsafe to continue the test and forcible extinction is required
	4.1.1 c) Smoulders until it is essentially consumed or that smoulders to the extremities of the
	specimen, i.e. to either side or to/through the full thickness of the specimen, within the duration of the test
	4.1.1 e) Externally detectable amounts of smoke, heat or glowing 60 minutes after ignition of the crib
	4.1.1 f) Final examination - evidence of charring within the filling (other than discolouration) more
	than 100 mm in any direction, apart from upwards, from the nearest part of the original position of
	the source Filling type: Combustion modified (FR) foam with a density of 35 Kg/m ³
Schedule 3 of The Furniture and	Filling type: VP45 Non FR modified foam with a density of 20-22 Kg/m ³ covered in 100% FR
Furnishings (Fire)(Safety) Regulations	polyester 220 g/m²
†BS 5852: Part 2:1982 (Ignition Source 5)
†BS 5852: Part 2: 1982 as modified by Schedule 2 Part 1 (non-foam filling	The test results relate only to the ignitability of the combinations of materials under the particular
materials) of The Furniture and	conditions of test; they are not intended as a means of assessing the full potential fire hazard of
Furnishings (fire) (safety) Regulations	the materials in use
1988 (Ignition Source 2)	
Technical Notes (listed by test method)	
†Schedule 3 of The Furniture and	The test results only relate to the ignitability of the combinations of materials under the particular
Furnishings (Fire)(Safety) Regulations BS 5852: Part 2:1982 (Ignition Source	conditions of test; they are not intended as a means of assessing the full potential fire hazard of the materials in use
5)	
AND	4.1.a) Externally detectable amounts of smoke, heat or glowing 30 minutes after the removal of the
AND	burner tube 4.1 b) Externally detectable amounts of amoke, host or allowing 60 min after ignition of the crib
†Schedule 1 Part 1 of the Furniture &	4.1 b) Externally detectable amounts of smoke, heat or glowing 60 min after ignition of the crib4.1 c) Escalating smouldering behaviour so that it is unsafe to continue the test and required forcible
Furnishings (Fire) (Safety) Regulations	extinction
1988 (As Amended)	4.1 d) Smoulders until it is essentially consumed within the test duration
BS 5852: Part 2: 1982 (Ignition Source	4.1 e) Smouldering reached the extremities of the test specimen (other than the top of the vertical part
5)	of the specimen) within the duration of the test
	4.1 f) On final examination shows evidence of charring, other than discolouration, more than 100 mm
AND	in any direction apart from upwards from the nearest part of the original position of the ignition source
†BS 5852: Part 2: 1982 as modified by Schedule 2 Part 1 (non-foam filling	4.2.a) The test specimen continued to flame for more than 120 seconds after the removal of the burner
materials) of The Furniture and	4.2 b) Continues to flame for more than 10 minutes after the ignition of the crib
	,

Eurofins BLC Leather Technology Centre Limited Kings Park Road, Moulton Park, Northampton, NN3 6JD Tel: +44 (0) 1604 679999

Website: www.blcleathertech.com email: ERFBLCinfo@cpt.eurofinseu.com



CPSC LABORATORY IDENTIFICATION NUMBER 1049

EFS624101027-CG-01 Job Ref:

Abitex SRL

AR-24-S6-009765-01 AR Ref:

Page No: Page 8 of 10



BLC

Furnishings (fire) (safety) Regulations 1988 (Ignition Source 2)	 4.2 d) Escalating combustion behavior rendered the test unsafe to continue and required forcible extinction 4.2 e) Flaming essentially consumed the test specimen within the duration of the test 4.2 f) Flaming reached the extremities of the test specimen (other than the top of the vertical part of the specimen) within the duration of the test 	
†Schedule 1 Part 1 of the Furniture & Furnishings (Fire) (Safety) Regulations 1988 (As Amended) BS 5852: Part 2: 1982 (Ignition Source 5)	*NOTE Schedule 1 Part 1 of the 1988 regulations (polyurethane foam in slab or cushion form) states that: If failure against the criteria of clause 4 of BS 5852: Part 2 has occurred but only by way of damage exceeding the limits defined in clauses 4.1(e), 4.1(f) and 4.2(f) and provided that the resultant mass loss (initial mass less final mass) is less than 60 g the foam passes the ignitability test.	
†BS 7177: 2008 + A1: 2011 Low Hazard Specification for Resistance to Ignition of Mattresses, Mattress Pads, Divans and Bed Bases.	The sample was subjected to conditioning for at least 72 hours in ambient indoor conditions followed by a minimum of 24 hours at a temperature of (23±2°C) and a relative humidity of (50±5%). The test result only relates to the ignitability of the combination of materials under the particular conditions of test. It is not intended as a means of assessing the full potential fire hazard of the mattress, mattress pad or upholstered bed base in use Butane Gas flowing at 45±2ml/min @ 25°C for 15±1 seconds A – Smouldering Criteria B – Flaming Criteria	
†TB 117 – 2013 (Section 1-Cover Fabric)	Ignition source: SRM 1196 Cigarette (see below for further information)	
†TB 117 – 2013 (Section 4-Decking)	Ignition source: SRM 1196 Cigarette (see below for further information)	
	The time of flame spread is measured from flame application to the severance of a trip thread.	
†16 CFR Part 1610 Standard for Flammability of Clothing Textiles (General Wearing Apparel)	CLASS Plain Surface textile fabric Raised Surface textile fabric 1 1) There are no burn times; or Burn time is 3.5 seconds or more – Burn time is 3.5 seconds or more – Burn time is 3.5 seconds or more – Burn time is 0 – 7 seconds with no base burns (SFBB) Exhibits rapid surface flash only – ACCEPTABLE 2 Class 2 is not applicable to plain surface textile fabrics (SFBB) – ACCEPTABLE 3 Burn time is less than 3.5 seconds – NOT ACCEPTABLE Burn time is less than 4.0 seconds with base burn (SFBB) – NOT ACCEPTABLE FOR PLAIN SURFACE TEXTILE FABRICS ONLY DNI = DID NOT IGNITE IBE = IGNITED, BUT EXTINGUISHED FOR RAISED SURFACE TEXTILE FABRICS ONLY SF uc = Surface flash, under the stop thread but does not break SF pw = Surface flash, part way. Did not reach stop thread SF poi = Surface flash, point of impingement only (Same as DNI) SF only = Time in sec & SF base burn starting other than poi SFBB poi = Time in sec & SFBB starting at the poi	

Eurofins BLC Leather Technology Centre Limited Kings Park Road, Moulton Park, Northampton, NN3 6JD Tel: +44 (0) 1604 679999

Website: www.blcleathertech.com email: ERFBLCinfo@cpt.eurofinseu.com



CPSC LABORATORY IDENTIFICATION NUMBER 1049 Job Ref: EFS624101027-CG-01

Abitex SRL

AR Ref: AR-24-S6-009765-01

Page No: Page 9 of 10



	SFBB poi* = Time in sec & SFBB starting possibly at poi * means there is a question to origin of base burn
Ignitability Testing to †BS 5852: Part 1:1979 as specified in Schedule 4, Part 2 and Schedule 5, Part 3 of the Furniture and Furnishings (Fire)(Safety) Regulations 1988 and	The test results only relate to the ignitability of the combinations of materials under the particular conditions of test; they are not intended as a means of assessing the full potential fire hazard of the materials in use
The Furniture and Furnishings (Fire) (Safety) (Amendment) Regulations 1989	Smouldering cigarette test – Filling type: VP45 Non FR modified foam with a density of 20-22 Kg/m ³ Butane flame test - Filling type: Combustion modified foam with a density of 24-26 Kg/m ³

	TB 117 – 2013 (Section 1-Cover Fabric)
Pass	/Fail/Repeat criteria: A material is considered to pass or fail based on following criteria according to technical Bulletin 117-2013, Section 1, item 3.4:
1	A single mock up- test specimen fails to meet the requirements of this test procedure if any of the following criteria occurs: a) The mock-up test specimen continues to smoulder after the 45 minute test duration; b) A vertical char length of more than 1.8 inches (45mm) develops on the cover fabric. c) The mock-up test transitions to open flaming.
2	The cover fabric passes the test if three initial mock-up specimens pass the test, i.e, the cigarettes burn their entire length and the mock-ups are no longer smouldering.
3	If more than one initial specimen fails, the cover fabric fails the test.
4	If any of the three initial specimen fails, repeat the test on additional three specimens.
5	If all three additional specimens pass the test, the cover fabric passes the test. If any one of the additional three specimens fails, the cover fabric fails the test.

	TB 117 – 2013 (Section 4-Decking Material)
Pas	s/Fail/Repeat criteria: A material is considered to pass or fail based on following criteria according to technical Bulletin 117-2013, Section 4,
	item 4.4:
1	A single mock up- test specimen fails to meet the requirements of this test procedure if any of the following criteria occurs:
	a) The mock-up test specimen continues to smoulder after the 45 minute test duration;
	b) A char length of more than 1.5 inches (38 mm) develops
	c) The mock-up test transitions to open flaming.
2	The decking material passes the test if three initial mock-up specimens pass the test, i.e., the cigarettes burn their full length and the
	mock-ups are no longer smouldering.
3	If more than one initial specimen fails, the decking material fails the test
4	If any of the three initial specimen fails, repeat the test on additional three specimens.
5	If all three additional specimens pass the test, the decking material passes the test. If any one of the additional three specimens fails,
	the decking material fails the test

Eurofins BLC Leather Technology Centre Limited Kings Park Road, Moulton Park, Northampton, NN3 6JD Tel: +44 (0) 1604 679999

Website: www.blcleathertech.com email: ERFBLCinfo@cpt.eurofinseu.com



CPSC LABORATORY IDENTIFICATION NUMBER 1049

EFS624101027-CG-01 Job Ref:

Abitex SRL

AR-24-S6-009765-01 AR Ref:

Page No: Page 10 of 10